



Room sensor NLII-RH is used to continuously monitor the air quality inside buildings and then control ventilation (HVAC) systems according to current levels of air pollution. The sensor measures the relative humidity (RH) and temperature (T). It is suitable for living rooms, bathrooms, warehouses, ateliers etc.

- > measures RH and temperature
- > 2x analog voltage/current output
- > IQRF wireless communication
- maintenance during operation is not required
- long life and stability



Sensor type / order code	RH output	T output	SIM slot	IQRF module
NLII-RH+T-IQRF	0-10 V/0-20 mA/4-20 mA <sup>1)</sup>	0-10 V/0-20 mA/4-20 mA <sup>1)</sup>	*	-
NLII-RH+T-IQRF+	0-10 V/0-20 mA/4-20 mA <sup>1)</sup>	0-10 V/0-20 mA/4-20 mA <sup>1)</sup>	*	*

<sup>&</sup>lt;sup>1)</sup> It is possible to select the desired type of analog output by a jumper on the electronics board.

#### Description

Measurement of the relative humidity is based on the principle of capacitive polymer sensor.

The sensor has built-in two separate analog outputs - one for the actual temperature and the other for the actual relative humidity.

So the sensor efficiently manages ventilation and heat recovery units, based on current room air quality. The current air quality can easily be determined by looking at the three LED indicators.

The *eco* level means good indoor air quality necessary to achieve a sense of well-being and at the same time optimal energy costs for heating, ventilation or air conditioning.

For detailed information about IQRF, use the document <u>NLII-IQRF-Communication</u>. For information on the communication protocol, use the document <u>NLII-Modbus-Communication</u>.

# **Technical data**


Parameter	Value	Unit	
Supply voltage range	12 – 35 12 – 24	V DC V AC	
Average consumption	0,2	W	
RH measuring range	0 – 100 %	RH	
RH accuracy 0 – 90 %	± 5 %	RH	
RH accuracy 90 – 100 %	± 6 %	RH	
T measuring range	0 – 50	°C	
T accuracy	± 0,4	°C	
Working temperature	0 to +50	°C	
Working humidity non condensing	0 – 90 %	RH	
Storage temperature	-20 to +60	°C	
Expected lifetime	min. 10	years	
Ingress protection	IP20		
Dimensions	90x80x31 mm		

Explanation of abbreviations and technical terms can be found on our website in the <u>Glossary</u> section.







## Analog output values versus actual RH

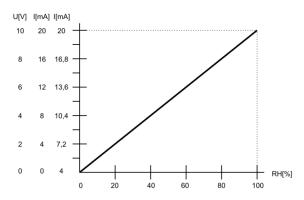

## Analog output values versus actual T

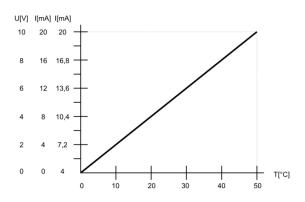

#### Typical T measurement accuracy

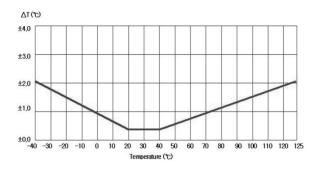

#### LED indication description

### White LED lights:

- Less than 40 % RH or less than 18 °C.

  (according to the quantity selected for indication)
  - low concentrations of RH. Too dry air feels cooler as compared to equally hot but more humid air – risk of drying of the mucous membranes - respiratory problems
  - low temperature and its higher fluctuation is not economically profitable

### **Green LED lights:**

- More than or equal to 40 % RH or 18 °C, less than or equal to 60 % RH or 22 °C.
  - (according to the quantity selected for indication)
  - optimal relative humidity for humans
  - optimal balance of air quality and energy efficiency of ventilation and air conditioning

#### **Yellow LED lights:**

- More than 60 % RH or more than 22 °C.
  (according to the quantity selected for indication)
  - too high humidity, the risk of mold growth and associated health complications
  - higher temperature T high temperature can cause fatigue, restlessness, headache and feeling hot

#### Sensor start after power on

All three LEDs flash simultaneously until the first readings are available, but no longer than 10 seconds.

### Sensor failure indication

All three LEDs are shining permanently.

#### **CAUTION:**

Warm-up: operational after 1 minute since power on. The declared accuracy is reached after 4 days of continuous power supply.


It is necessary to avoid severe mechanical shock of the sensor.







### **Electronic board controls and terminals**

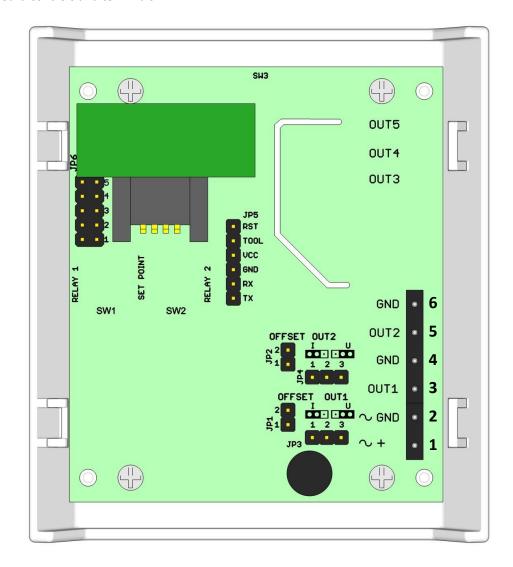

### **Terminals**

6. GND

1. ~ +	supply AC or DC (+) plus pole
2. ~ GND	supply AC or DC (-) minus pole, GND
3. OUT1	T sensor analog output, 0-10 V or 0-20 mA
	or 4-20 mA
4. GND	T sensor output GND
5. OUT2	RH sensor analog output, 0-10 V or 0-20
	mA or 4-20 mA

RH sensor output GND

## Jumpers

JP1 – Current output offset RH
JP2 – Current output offset T
JP3 – Voltage/current output T
JP4 – Voltage/current output RH
JP6 – LED indication settings







## Jumpers on the electronics board

Mark	Description	Settings	Meaning
JP1	Current output offset RH	2 <b>1</b>	current output RH 0-20 mA
	- shift quiescent current from 0 mA to 4 mA	2 🗖	current output RH 4-20 mA
JP2	Current output offset T	2 • 1 •	current output T 0-20 mA
	- shift quiescent current from 0 mA to 4 mA	2 1	current output T 4-20 mA
JP3	Voltage/current output T  - select the type of analog output	1 2 3	voltage output T
	- if voltage output T is selected, JP2 must not be shorted	1 2 3	current output T
JP4	Voltage/current output RH - select the type of analog output	1 2 3	voltage output RH
	- if voltage output RH is selected, JP1 must not be shorted	1 2 3	current output RH
JP6 - 1 JP6 - 3	LED indication LED signalization by VOC or RH	<b>5 4</b>	
	-LED indication according to ambient light - when ambient light is dimmed (at night),	<b>3 2</b>	LED indication by VOC
	LED indicators turn off automatically factory setting is indication by VOC	<b>1 1 5</b>	LED indication according to ambient light
		<b>4</b>	150 1 1 1 1 1
		<b>3 2 4</b>	LED indication by RH permanent LED indication enabled
JP6 - 2	These positions are not intended for user	<b>9 9</b> 1	permanent LED indication enabled
JP6 - 4	setting.	<b>a a</b> 5	
JP6 - 5		<b>a a</b> 3	
		<b>2</b>	
		<b>■ ■</b> 1	

## **Factory settings**

LED indication: by RH, indication turns off


when ambient light dims

T analog output: voltage output RH analog output: voltage output






Example of RH sensor connection for direct EC motor control using 0-10 V signal

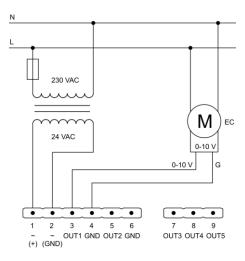

If you connect other devices to the same AC power source as the NL sensor, it is necessary to meet GND wiring of all analog inputs and outputs, as well as power wires.

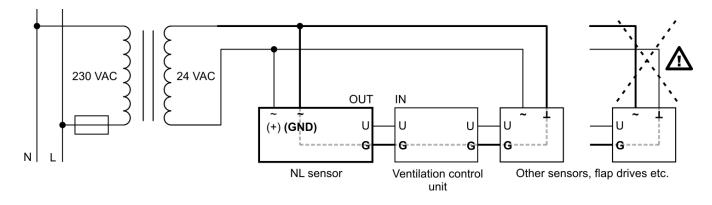





#### Sensor assembly



#### **Box color**

Front: White - RAL9016 Base: gray - RAL7035


### Way to use


The product is intended for indoor use only. You can read the <u>recommendations for sensor placement</u> on our web pages.


### **End of product life**

Discard the product in according to the electronic waste law and the EU directives.

#### **Dimensions**

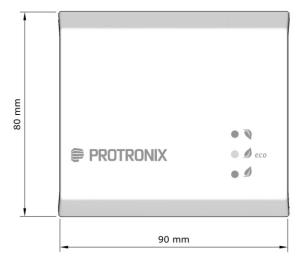



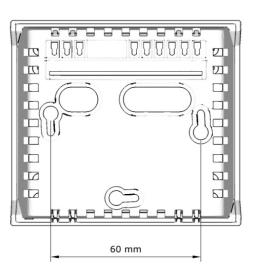

The producer reserves the right of technical changes in order to product improvements its properties and functions without previous notice.

